

TELEVISION TECHNICAL BULLETIN

<u>MODELS</u>	56FW53H	66FW53H	66FW54H	76FW53H	76FW54H
	66GF63H	66GF64H	76GF63H	76GF64H	28HW53H
	32HW53H				

SYMPTOM Set shuts down at start up (EHT sometimes comes up, but then the set shuts down). This can be intermittent. Once the set has started up, it will run until the mains is removed.

CAUSE Dry joints on IC2402. This IC is mounted on the print side of the PWB, underneath the Teletext Processor (IC2401).

Note that IC2402 may not be fitted on some sets.

ACTION Resolder all pins on IC2402.

Sharp Electronics (UK) Limited

Reference JC 12 03 2004 - 1
Revision 1

White – Carry out as required
Yellow – Carry out as required and whenever the unit comes in for service
Red – Carry out on all units